


Corrigenda Geberit PP-HT Brochure

Page 6 (edition GEAU0034/12.08)

A print mistake on page 6 may lead to some confusion and is herewith corrected and clarified.


Black indicator (arrow) on Z2 values for PP-HT Junction 45° and PP-HT Junction 87° are not in line with Z2 value (mm) outlined on table below the picture. Red indicator (arrow) refers to correct Z2 value (mm) outlined on table below the picture.

PP-HT Junction 45°

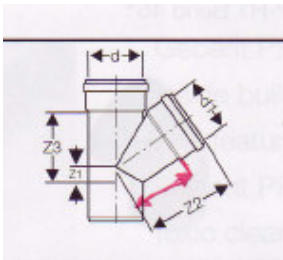

Article No.	d [mm]	d1 [mm]	Z1 [mm]	Z2 [mm]	Z3 [mm]
391.200.00.1	40	40	10	49	49
391.201.00.1	50	40	5	56	54
391.211.00.1	50	50	12	61	61
391.212.00.1	75	50	-1	79	74
391.222.00.1	75	75	17	91	91
391.213.00.1	110	50	-17	104	91
391.223.00.1	110	75	0	116	109
391.233.00.1	110	110	25	133	133
391.235.00.1	160	110	2	166	158
391.255.00.1	160	160	36	194	313

PP-HT Junction 87°

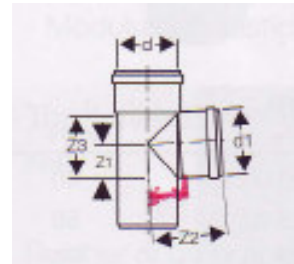

Article No.	d [mm]	d1 [mm]	Z1 [mm]	Z2 [mm]	Z3 [mm]
391.400.00.1	40	40	23	24	24
391.401.00.1	50	40	22	29	24
391.411.00.1	50	50	27	29	29
391.412.00.1	75	50	27	42	30
391.422.00.1	75	75	39	43	43
391.413.00.1	110	50	27	59	30
391.423.00.1	110	75	40	60	44
391.433.00.1	110	110	57	61	61
391.435.00.1	160	110	59	83	63
391.455.00.1	160	160	36	162	313

Date of issue: September 9, 2009

The information contained is subject to change without notice. The information provided contains general description of the technical options available, which do not always apply to individual cases. The required features should therefore be individually clarified in accordance with individual situations at the time of proceeding.